N&W GLOBAL VENDING

TECHNICAL INFORMATION

WITTENBORG

TYPE NO	TYPE	T.I.-NO
XX2800	All types	2800-2005-01

SERIAL NUMBERS AFFECTED: Before and including machine number 560343	ISSUED BY: Documentation/ Wittenborg Odense
SUBJECT: Adjustment of actuator on drip tray	ISSUED FOR (X): Action / Information: x

HEADLINE

- The bend of the actuator on the drip tray in door has been changed in all machines from machine number 560344 to ensure correct functioning of the drip tray when replacing the obsolete waste bucket with new one, refer to T.I. 2800_02/2004.

COMPONENTS CONCERNED

- **Obsolete part**
  39400700 Waste Bucket

  New part
  39722800 Waste Bucket

MODIFICATION

- The angle of the bend is changed from 20° into 40°.

ADJUSTMENT ON REPLACEMENT OF OLD WASTE BUCKET

- The actuator on the drip tray in machines before machine number 560344 needs to be adapted to the new waste bucket - part no 39722800 - as follows:

1. Open the door and place the waste bucket in its brace (ill. 1).

2. Bend the actuator until the angle is approx. 40° (ill. 2).

Ill. 1

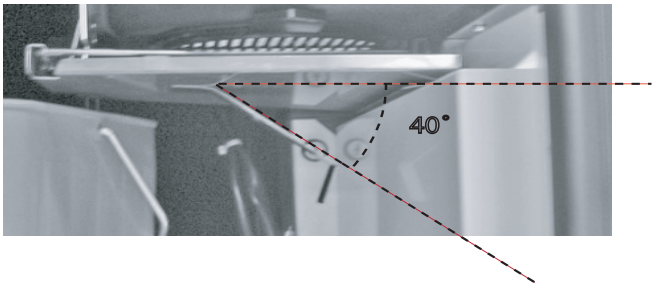

Ill. 2

Tip!
- remove drip tray and grid,
- reinsert drip tray without grid,
- close the door,
- and observe the drip tray through the hole for grid.

If the drip tray is sloping towards the waste bucket, the angle of the actuator is correctly adjusted. Reinsert grid again.

REMINDER

- When replacing an old type bucket (39400700) with the new bucket (39722800), a new holder for waste bucket (39280400) must be fitted.